



Test Report

Report No: Y000022M001

Date of issue: August 17 2020

Client	LA BUENA SEMILLA LIMITED		
Manufacturer	LA BUENA SEMILLA LIMITED		
Product	Melt-blown fabric		
Model	MT-FJ, 25gsm		
Test Type	Commissioned inspection		





Page 1 of 4 Report No.: Y000022M001

Product	Melt-blown fabric	Sample No.	Y000022-1- S0001	
Brand/Trademark	LBS	Model	MT-FJ, 25gsm	
Client	LA BUENA SEMILLA LIMITED	Test Type	Commissioned inspection	
Client Address	t Address NO. 5, 17/F, STRAND 50, 50 BONHAM STRAND, SHEUNG WAN HONG KONG Product No./ Batch No.			
Manufacturer	LA BUENA SEMILLA LIMITE	Sampling Form No.		
Inspection Company		Production Date		
Sampling Company	Sampling Si		1	
Sampling Address	ipling Sampling Base			
Date of Sampling		Test Address	Medical protection laboratory	
Date of Sample Receiving	2020-08-13	Date of Tests	2020-08-13	
Test Specification	EN 14683: 2019+AC			
Basis of Judgment	EN 14683: 2019+AC			
Classification	/			
Test Result	The report is inconclusive.See details for specific results			
Remarks	"" in the report means this item is not applicable,"/" in the report means this item is blank.			

compiled: Lani wang Reviewed: Daniel, Shi Approved: Tom Kne



Page 2 of 4

Report No.: Y000022M001

No.	Test Items	Spec Chapt er	Requirements			Test Da	ata		Assessm ent
1	Bacterial filtration	5.2.2	≥95%	100	99.9	100	100	98.9	
	efficiency (BFE) %	5.2.2		Please refer to appendix Table 5.2.2 for details				,	

Note: /



Report No.: Y000022M001



5.2.2 TABLE: Bacterial filtration efficiency (BFE)

Batch/ lot no.:	Test Speci - men no.:	Flow rate (I/min)	Positive quality control value	Mean plate count of the negative controls	BFE for each test specimen (%)	Remarks
2020- 08-	1	28.3	2078	0	100	≥95%
	2	28.3	2078	0	99.9	≥95%
	3	28.3	2078	0	100	≥95%
	4	28.3	2078	0	100	≥95%
	5	28.3	2078	0	98.9	≥95%


Supplementary information:

Each specimen was conditioned at 21 °C and 85 % relative humidity for 4 h to bring them into equilibrium with atmosphere prior to testing.



Report No.: Y000022M001



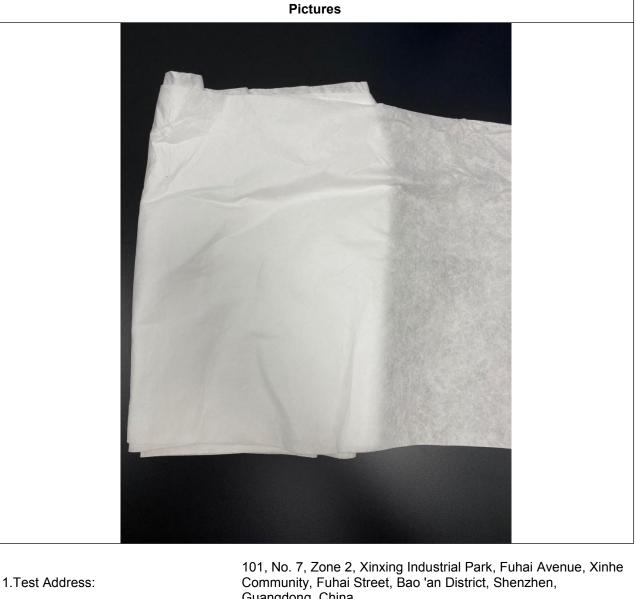

1.Test Address:	Community, Fuhai Street, Bao 'an District, Shenzhen, Guangdong, China.
2.Client Address:	NO. 5, 17/F, STRAND 50, 50 BONHAM STRAND, SHEUNG WAN HONG KONG
3.Test environmental/conditions:	The test items are carried out under the conditions specified in the corresponding specifications (except where noted)
4.Sampling procedures (if applicable):	
5.Description of deviation from standard method (if applicable):	
6.Explanation of uncertainty of test results (if applicable):	
7.Subcontracting projects and subcontractors (if applicable):	

This test report is valid for the tested samples only. It cannot be reproduced except in full without prior written consent of Shenzhen